

COLOR READER CR-20

Simple operation shows colorimetric values for samples in various forms, from solids to powders, pastes, etc. in a instant.

Simple basic operation. Just three steps:


Switch on → Do white calibration → Measure samples

Lightweight and compact!

Can display results in any of eight color spaces and colorimetric indexes!



The Standard in Measuring Color & Light



27.2

MENU/OK

Main features



Display data in a variety of color spaces and colorimetric indexes

You can select one color space or color index for the measurement data among the eight color spaces and colorimetric indexes available: L*a*b*, L*C*h, Yxy, Munsell (D65), WI (CIE/ASTM E 313-96), Tint (CIE/ASTM E 313-96), YI (ASTM E 313-96).


Averaging function

If sample color is uneven, you can measure several points and then obtain the average result by pressing the Average button.



Data Memory

Using the PC application stored in the CR-20, you can set the instrument to store data internally. (Memory capacity: 1,000 data)

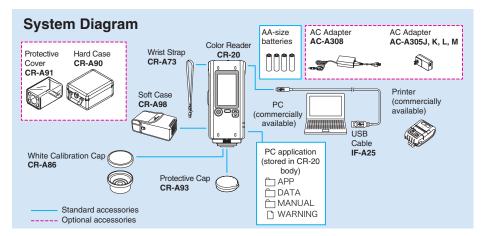

Main Specifications

Model	Color Reader CR-20
Illumination/viewing system	8°: de (8°illumination angle/diffuse viewing: specular component excluded) (conforms to DIN 5033 Teil 7, JIS Z 8722 condition d, ISO 7724/1, CIE No. 15, ASTM E 1164)
Detector	Silicon photocells (6 pcs.)
Light source	Pulsed xenon lamps
Measurement time	Approx. 1 sec.
Battery performance	Approx. 2,000 measurement at 10-sec. intervals when using alkaline-manganese batteries
Measurement area	Approx.: ø8 mm
Repeatability	Standard deviation within ∆E*ab 0.1 (when a white calibration plate is measured 30 times at 10-second intervals)
Display languages	English, Japanese
Interface	USB2.0
Observer	10° Standard Observer
Illuminant	D65
Display data	Colorimetric data, average (up to 999 times)
Color spaces	L*a*b*, L*C*h, Yxy, XYZ, Munsell (D65)
Colorimetric Indexes	WI (CIE/ASTM E 313-96), Tint (CIE/ASTM E 313-96), YI (ASTM E 313-96)
Data memory	Sample data (up to 1,000)
Operation temperature/ humidity range	0 to 40°C, relative humidity 85% or less (at 35°C) with no condensation
Storage temperature/ humidity range	-20 to 40°C, relative humidity 85% or less (at 35°C) with no condensation
Power	4 AA-size alkaline dry batteries or nickel-metal-hydride rechargeable batteries, USB bus power or special AC Adapter
Size (W x H x D)	66 x 159.5 x 85 mm
Weight	420 g (without batteries)

SAFETY PRECAUTIONS

- For correct use and for your safety, be sure to read the instruction manual before using the instrument.
- Always connect the instrument to the specified power supply voltage. Improper connection may cause a fire or electric shock

Osaka, Japan

KONICA MINOLTA, INC. Konica Minolta Sensing Americas, Inc. Konica Minolta Sensing Europe B.V.

Konica Minolta (CHINA) Investment Ltd.

Konica Minolta Sensing Singapore Pte Ltd.

Konica Minolta Sensing Korea Co., Ltd.

New Jersey, U.S.A. European Headquarter /BENELUX German Office French Office UK Office Italian Office Swiss Office Nordic Office Polish Office Turkish Office SE Sales Division Beijing Office Guangzhou Office Chongqing Office Qinadao Office Wuhan Office

München, Germany Roissy CDG, France Warrington, United Kingdom Cinisello Balsamo, Italy Dietikon, Switzerland Västra Frölunda, Sweder Wroclaw, Poland Istanbul, Turkey Shanghai, China Beijing, China Guangdong, China Chongqing, China Shandong, China Hubei, China Singapore Goyang-si, Korea

Nieuwegein, Netherlands

Phone: 888-473-2656 (in USA), 201-236-4300 (outside USA) Phone: +31(0)30 248-1193 Phone: +49(0)89 4357 156 0 Phone: +33(0) 1 80 11 10 70 Phone: +44(0) 1925 467300 Phone: +39 02849488.00 Phone: +41 (0) 43 322-9800 Phone: +46(0)31 7099464 Phone: +48(0)71 73452-11 Phone: +90 (0) 216-528 56 56 Phone: +86-(0)21-5489 0202 Phone: +86-(0)10-8522 1551 Phone: +86-(0)20-3826 4220 Phone: +86-(0)23-6773 4988

Phone: +86-(0)532-8079 1871 Phone: +86-(0)27-8544 9942 Phone: +65 6563-5533 Phone: +82(0)2-523-9726

Fax: +31(0)30 24 81 211 Fax: +49(0)89 4357 156 99 Fax: +33(0)1 80 11 10 82 Fax: +44(0) 1925 711143 Fax: +39 02849488.30 Fax: +41 (0) 43 322-9809 Fax: +48 (0)71 734 52 10 Fax: +90 (0) 212-253 49 69

Fax: +86-(0)21-5489 0005 Fax: +86-(0)10-8522 1241 Fax: +86-(0)20-3826 4223 Fax: +86-(0)23-6773 4799 Fax: +86-(0)532-8079 1873 Fax: +86-(0)27-8544 9991 Fax: +65 6560-9721 Fax: +82(0)31-995-6511

https://konicaminolta.com/instruments/network


Other features

A protective glass

The CR-20's tip has a protective glass plate, so you can measure all kinds of samples such as powders, pastes, and wet objects, directly.

Printer

By connecting a printer to the CR-20, you can print out measured data.

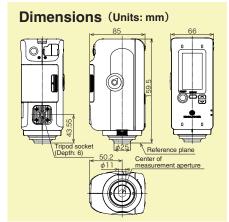

PC system requirement

- OS Windows® 7 Professional 32bit, 64bit Windows® 8 Pro 32bit, 64bit Windows® 8 .1 Pro 32bit, 64bit Windows® 10 Pro 32bit, 64bit (English, Japanese)
- The hardware of the computer system to be used must meet or exceed the recommended system requirements for compatible OS being used.
- · One USB2.0 port is necessary
- · The specifications and appearance shown herein are subject to change without notice.
- · KONICA MINOLTA, the Konica Minolta logo and symbol mark, and "Giving Shape to ideas" are registered trademarks or trademarks of KONICA MINOLTA, INC.
- · Other company names and product names used herein are trademarks or registered trademarks of their respective companies.



Fax: 201-785-2482

Addresses and telephone/fax numbers are subject to change without notice. For the latest contact information, please refer to the KONICA MINOLTA Worldwide Offices web page :